



- Thermopile IR-Sensor
- Filter for NDIR CO2 Gas Detection
- Single Element
- Very High Signal
- Flat Filter
- Small Package
- Accurate Reference Sensor

DESCRIPTION

Thermopiles are mainly used for contactless temperature or non-dispersive infrared measurement in many applications. Their function is to transfer the heat radiation emitted from the objects or other infrared sources into a voltage output.

FEATURES

APPLICATIONS

- Very High Signal
- Accurate Reference Sensor
- 4.26µm Narrow Band Pass
- Small TO-18 package

• NDIR CO₂ Gas Detection

ABSOLUTE MAXIMUM RATINGS

Parameter	Symbol	Min	Typical	Max	Unit	Description
Storage Temperature	T _S	-20	+20	+85	℃	permanent
Storage Temperature	Ts	-20	+20	+100	℃	non permanent



PERFORMANCE SPECS

Parameter	Symbol	Value	Unit	Condition
Operating Ambient Temperature	T_{Amb}	-20 to +85	℃	permanent
Operating Ambient Temperature	T _{Amb}	-20 to +100	℃	non permanent
Package		TO-18		
Absorber Area	Α	1.4 × 1.4	mm ²	
Thermopile Resistance	R _{TP}	180 ± 60	kΩ	$T_{Amb} = +25$ °C
Temperature Coefficient of Thermopile Resistance	TCR _{TP}	-0.06 ± 0.04	%/K	T _{Amb} = +25 °C to +75 °C
Voltage Response	V _{TP}	depends on light source	mV	
Temperature Coefficient of Voltage Response	TCV _{TP}	-0.45 ± 0.08	%/K	T _{Amb} = +25 °C to +75 °C
Noise Equivalent Voltage	NEV	130	nV/Hz ^{1/2}	T _{Amb} = +25 ℃
Rise Time	τ_{63}	22 ± 5	ms	
Ambient Temperature Sensor		Ni-RTD		
Ambient Temperature Sensor Resistance	R _{Ni-RTD}	1000 ± 4	Ω	T _{Amb} = 0 ℃
Temperature Coefficient of Ni-RTD	TC _{Ni-RTD}	6178 ±150	ppm/K	T _{Amb} = 0 °C to +100 °C



OPTICAL CHARACTERISTICS

Parameter	Symbol	Value	Unit	Description
Field of View	FOV	110	deg	at 50% of maximum signal

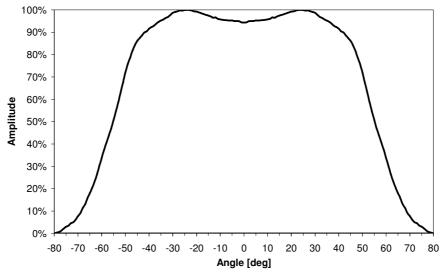


Figure 2: Field of View Curve

FILTER CHARACTERISTICS

Parameter	Symbol	Value	Unit	Description
Filter Type	NBP	4.26 ±0.18	μm	Narrow Band Pass

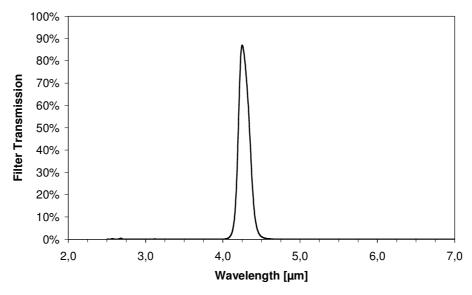


Figure 3: Filter transmission curve



ELECTRICAL CONNECTIONS

Pin	Symbol		
1	TP +		
2	Ni-RTD		
3	TP -		
4	GND		

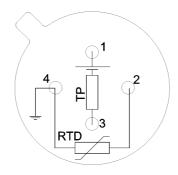


Figure 4: Electrical connections - bottom view of thermopile

MECHANICAL DIMENSIONS

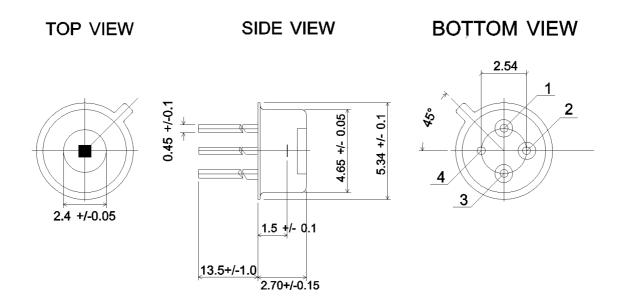


Figure 5: Mechanical dimensions of thermopile



ORDERING INFORMATION

Part Descripton TS418-1N426

Part No. G-TPCO-035

TECHNICAL CONTACT INFORMATION

NORTH AMERICA EUROPE ASIA Measurement Specialties China Ltd. Measurement Specialties, Inc. MEAS Deutschland GmbH 910 Turnpike Road No. 26, Langshan Road Hauert 13 High-tech Park (North) Shrewsbury, MA 01545 D-44227 Dortmund Nanshan District, Shenzhen 518057 **United States** Germany Phone: +49-(0)231-9740-0 Phone: +1-508-842-0516 China Fax: +1-508-842-0342 Fax: +49-(0)231-9740-20 Phone: +86-755-33305088 Fax: +86-755-33305099 Email: info.de@meas-spec.com Email: Web: www.meas-spec.com temperature.sales.amer@meas-Email: temperature.sales.asia@measspec.com Web: www.meas-spec.com spec.com Web: www.meas-spec.com

The information in this sheet has been carefully reviewed and is believed to be accurate; however, no responsibility is assumed for inaccuracies. Furthermore, this information does not convey to the purchaser of such devices any license under the patent rights to the manufacturer. Measurement Specialties, Inc. reserves the right to make changes without further notice to any product herein. Measurement Specialties, Inc. makes no warranty, representation or guarantee regarding the suitability of its product for any particular purpose, nor does Measurement Specialties, Inc. assume any liability arising out of the application or use of any product or circuit and specifically disclaims any and all liability, including without limitation consequential or incidental damages. Typical parameters can and do vary in different applications. All operating parameters must be validated for each customer application by customer's technical experts. Measurement Specialties, Inc. does not convey any license under its patent rights nor the rights of others.